CAN bus parameters not accessible in MFR300 - 8444-1093 Rev. C

Özgür Tosun - 2025-09-04 - MFR300

There is a little challenge with the *.wtool files of the MFR-300, Part-Number: 8444-1093 Rev. B and C not showing certain parameters
when opened in ToolKit Version 6.4 and higher.


With the *.wtool of Rev. A it works with no issue.
-> The CAN parameters are accessible.

Solution:

Just install the config files of 8444-1093 A (.msi-installer-file attached), and connect with ToolKit to your 8444-1093 C device.


There is actually no changes in parameter between Rev. A and C.

When connected with 8444-1093_C.wtool (or _B.wool), the CAN parameters are hidden.

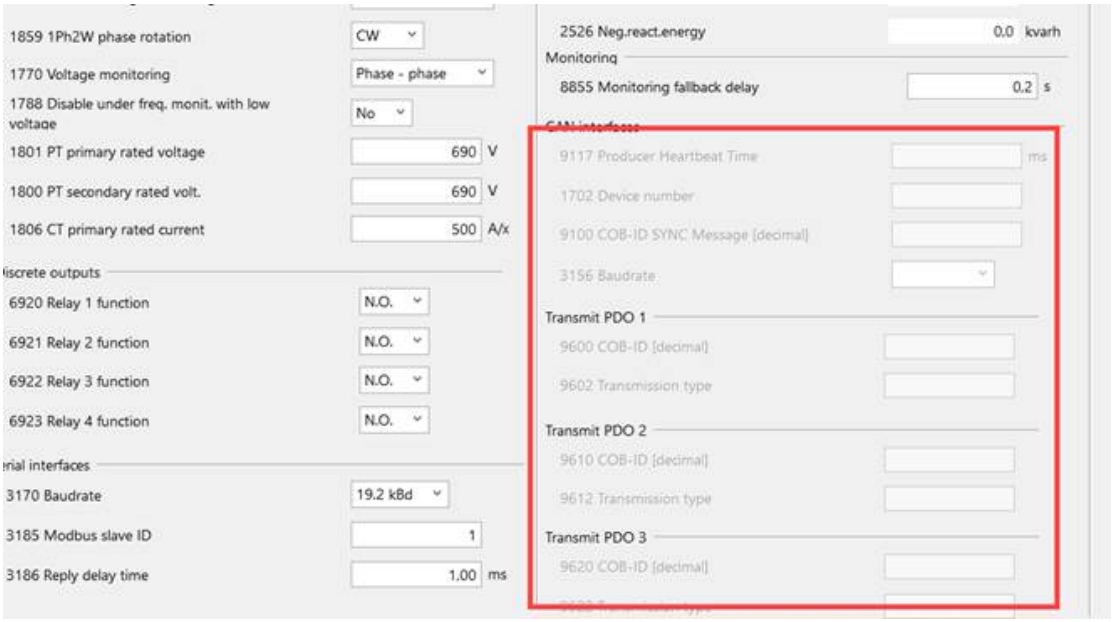

Connecting by 8444-1093_A.wtool

-> No issue anymore.

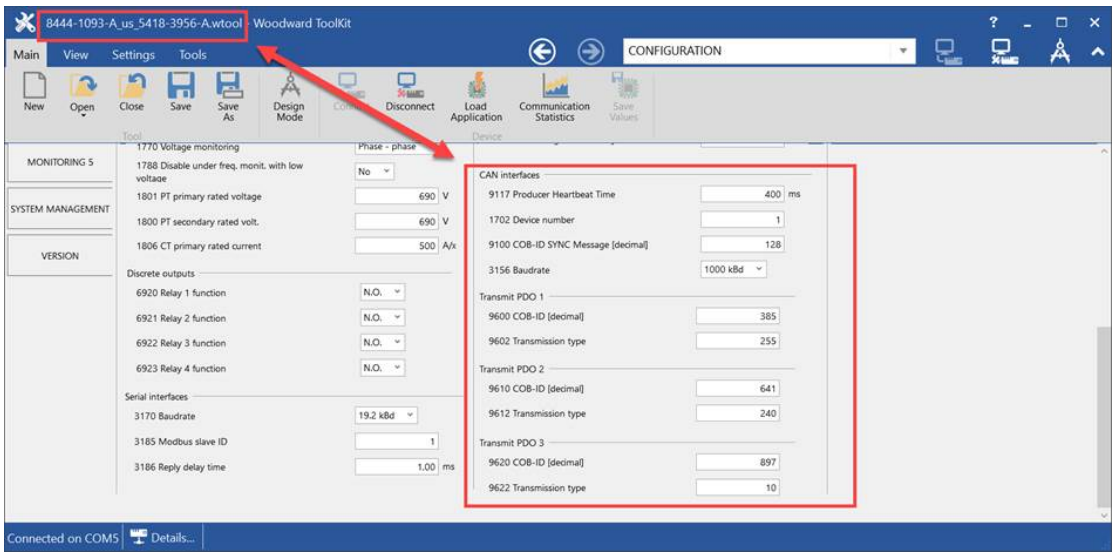

添付

- 8444-1093_A_Multilingual_ToolKit.msi (828.00 KB)